


Assembly method of coaxial connector


Part no	CN00380-7/2	TITLE	TNC50 CABLE PS LMR400
Page.	No.1	DATE	2019. 12. 20.




RF & MICROWAVE
TECHNOLOGY
Tel : 82-32-347-8015
Fax : 82-32-347-8017

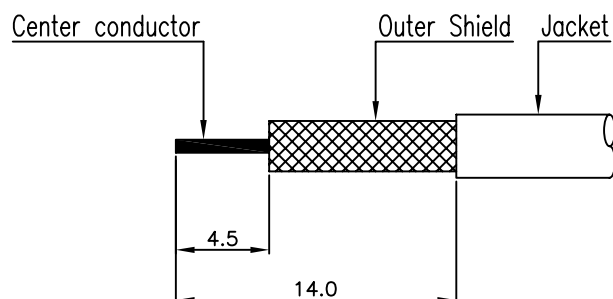


[No. 1] Strip the cable to the dimension as shown above.

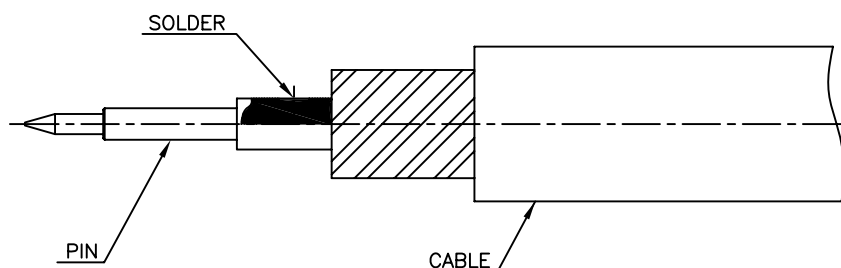

[No 2.] Solder cable conductor to connector pin.

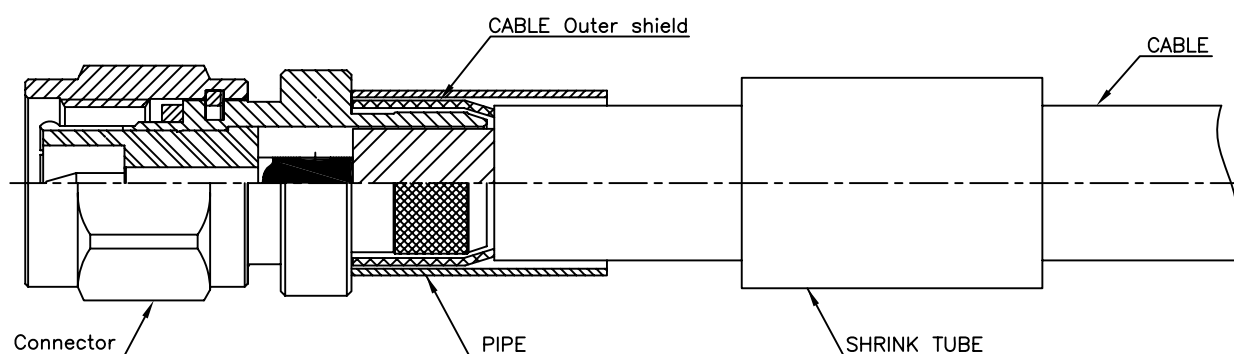

[No 3.] Slide shrink tube & pipe onto cable and solder cable outer shield.

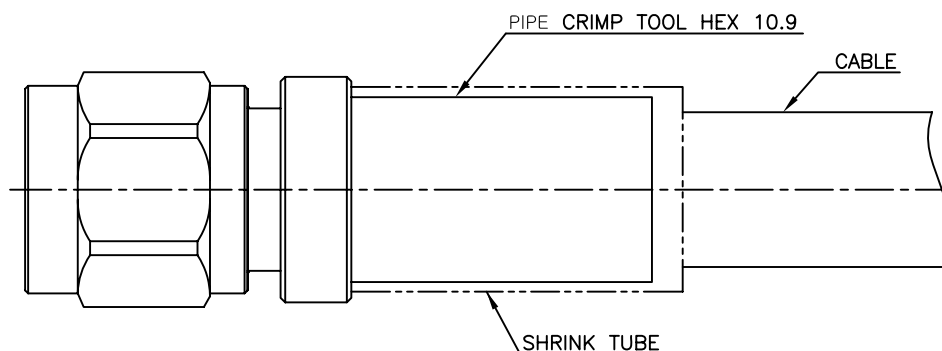

[No 4.] Use CRIMP HEX 10.9 to press the PIPE and then heat shrink tube.