


A


B

C

D

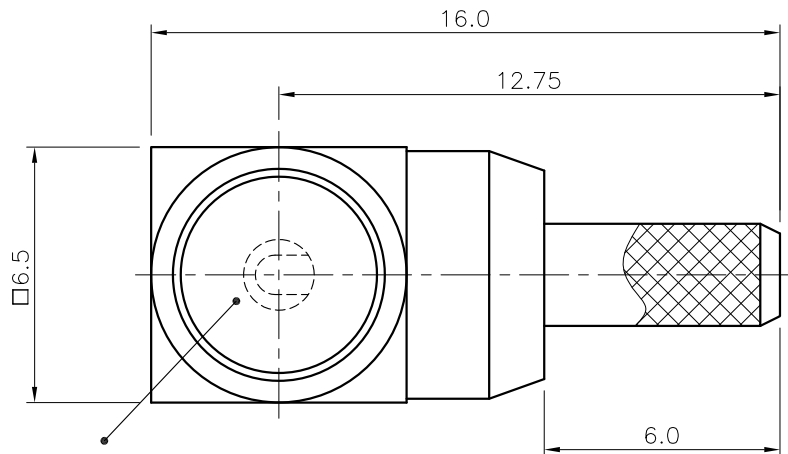



Connector Pin 조립 시 방향 주의할 것
(특성개선으로 인한 핀 한쪽 막혀있는 제품)

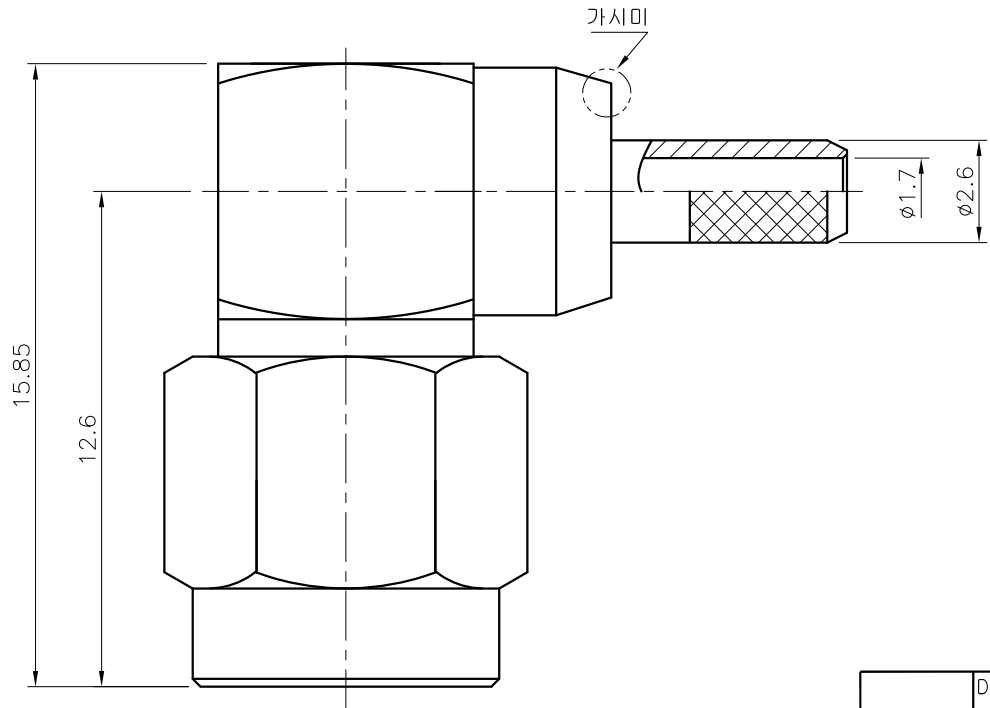

■조립순서

- 1번 바디에 5번 절연체 조립 이후 3번 핀 조립
- 1번 바디에 2번 바디 억지끼움
- 6번 절연 절연체를 넣고 8번 COVER를 억지끼움
- 4번 GASKET 조립, 9번 C-RING, 7번 CAP을 조립

REVISION				
REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	S.Y.EUN	I.C.KIM	2020.11.09.
1	CN02986-7/2 ↔ CN02986-7/4 BOM 크로스 전환	S.Y.EUN	I.C.KIM	2020.11.10.
2	조립 후 BURR발생 개선 공정 내용 추가 및 부품코드 변경	S.H.KIM		2024.10.08.

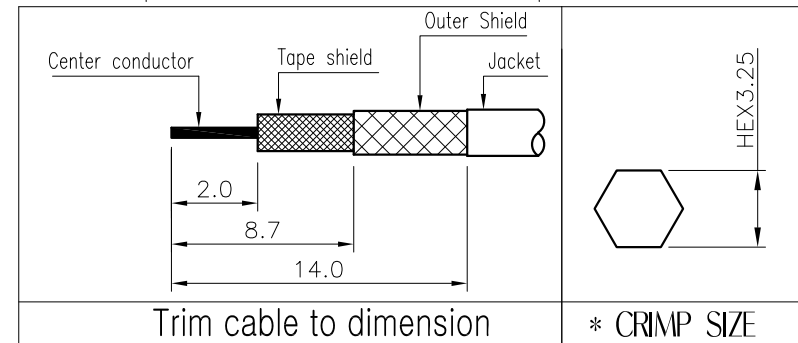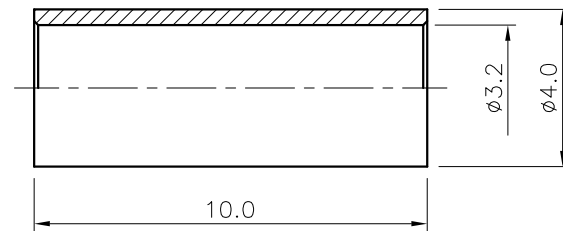

10	FERRULE	1	MBsBD C3604BD-F	Nickel Plate	DFE00034-5/1
9	RING	1	SUS	부동태 처리	DSR00002-5/1
8	COVER	1	MBsBD C3604BD-F	Nickel Plate	DCO00114-5/1
7	CAP	1	MBsBD C3604BD-F	Nickel Plate	DCU00005-5/2
6	INSULATOR	1	TEFLON		DIN00921-N/1
5	INSULATOR	1	TEFLON		DIN02129-N/1
4	GASKET	1	SILICONE RUB		DGK00004-N/1
3	CONTACT	1	MBsBD C3604BD-F	Gold Plate	DCT00300-5/6
2	BODY (B)	1	MBsBD C3604BD-F	Nickel Plate	DBD03327-5/6 DBD03327-5/5
1	BODY (A)	1	ZnDC	Nickel Plate (3~4μm)	DBD02994-5/3
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal ±0.2	DATE 2024. 10. 08.			 RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017
	Angle ±1°	APPROVED BY			
MATERIAL _____	CHECKED BY			TITLE SMA50 CABLE PL SIFS	
	DRAWN BY S.H.KIM				
FINISH _____	SCALE 5/1	UNIT mm		A4	DWG NO. CN02986-7/2
					REVISION 2

A

B

C

D