



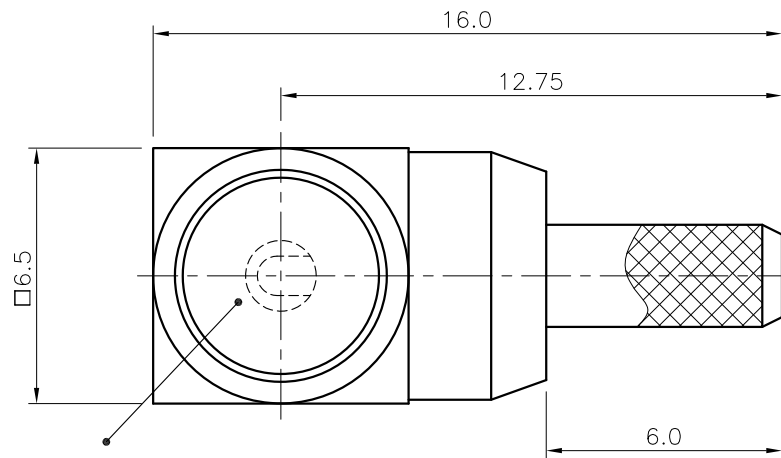

Connector Pin 조립 시 방향 주의할 것
(특성개선으로 인한 핀 한쪽 막혀있는 제품)


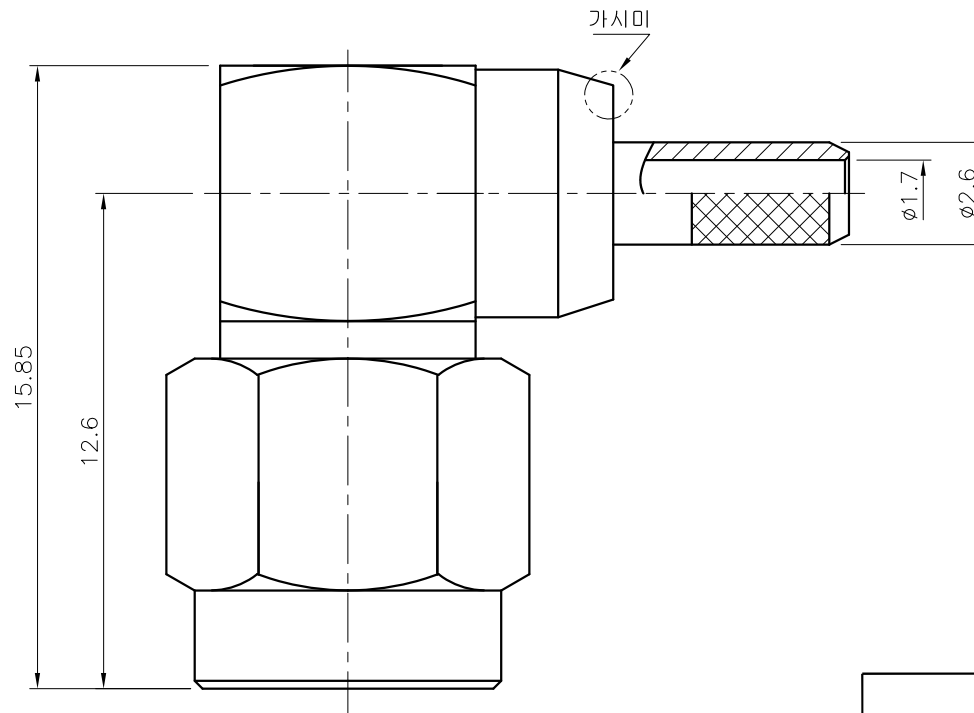


■조립순서

- 1번 바디에 5번 절연체 조립 이후 3번 핀 조립
- 1번 바디에 2번 바디 억지끼움
- 6번 절연 절연체를 넣고 8번 COVER를 억지끼움
- 4번 GASKET 조립, 9번 C-RING, 7번 CAP을 조립

REVISION

REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	S.Y.EUN	I.C.KIM	2020.11.09.
1	CN02986-7/2 ↔ CN02986-7/4 BOM 크로스 전환	S.Y.EUN	I.C.KIM	2020.11.10.

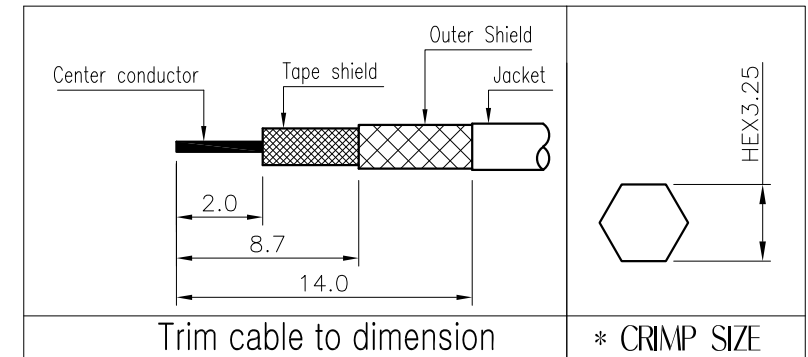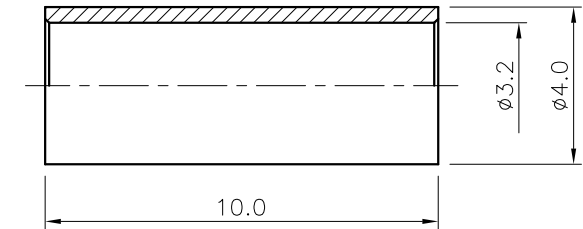

10	FERRULE	1	MBsBD C3604BD-F	Nickel Plate	DFE00034-5/1
9	RING	1	SUS	부동태 처리	DSR00002-5/1
8	COVER	1	MBsBD C3604BD-F	Nickel Plate	DCO00114-5/1
7	CAP	1	MBsBD C3604BD-F	Nickel Plate	DCU00005-5/2
6	INSULATOR	1	TEFLON		DIN00921-N/1
5	INSULATOR	1	TEFLON		DIN02129-N/1
4	GASKET	1	SILICONE RUB		DGK00004-N/1
3	CONTACT	1	MBsBD C3604BD-F	Gold Plate	DCT00300-5/6
2	BODY (B)	1	MBsBD C3604BD-F	Nickel Plate	DBD03327-5/5
1	BODY (A)	1	ZnDC	Nickel Plate (3~4μm)	DBD02994-5/3
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal ±0.1	DATE 2020. 11. 10.			 RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017
	Angle ±1°	APPROVED BY	I.C.KIM		
MATERIAL _____	CHECKED BY				TITLE SMA50 CABLE PL SIFS
	DRAWN BY	S.Y.EUN			
FINISH _____	SCALE 5/1	UNIT mm		A4	DWG NO. CN02986-7/2
					REVISION 1