



REVISION				
REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	H.J.LEE	I.C.KIM	2015.10.30.
1	[설번No.202201-0009] PIPE 압착 후 BURR 발생 개선으로 인한 PIPE 변경	S.Y.EUN	S.H.KIM	2022.01.10.

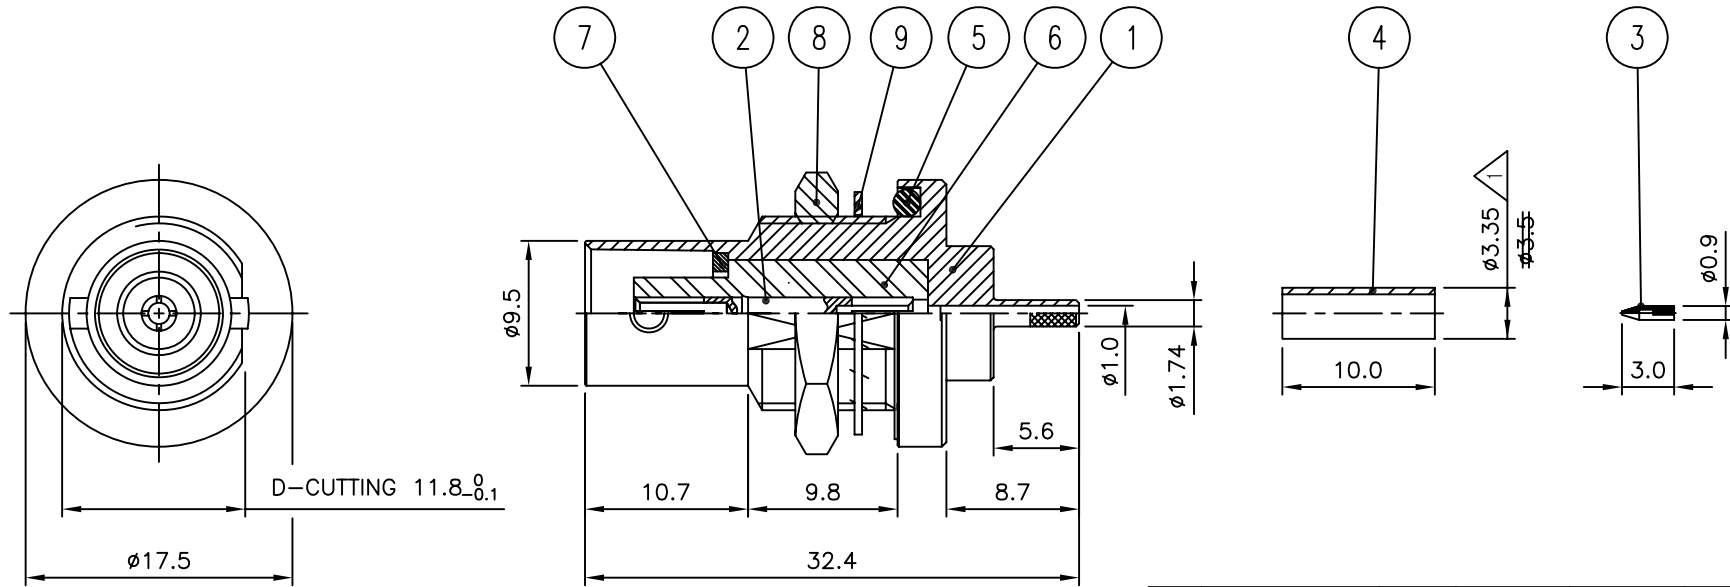

* 조립시 PIN 낚시바늘 위치 주의하여 조립 할 것

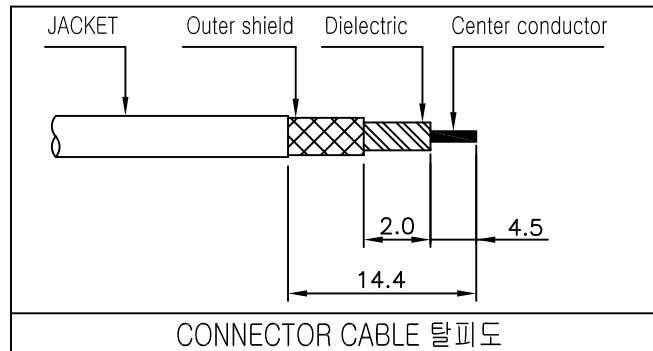

9	WASHER	1	MBsBD C3604BD-F	Nickel Plate	DWA00022-5/1
8	NUT	1	MBsBD C3604BD-F	Nickel Plate	DNT00020-5/1
7	고정 RING	1	MBsBD C3604BD-F	Nickel Plate	DSR00051-5/1
6	INSULATOR	1	TEFLON		DIN02676-N/1
5	GASKET	1	SILICONE RUB		DGK00036-N/1
4	FERRULE	1	MBsBD C3604BD-F	Nickel Plate	DFE00018-5/2 DFE00010-5/2
3	CONTACT	1	MBsBD C3604BD-F	Gold Plate	DCT00982-5/1
2	CONTACT	1	BeCu C17300	Gold Plate	DCT03583-5/1
1	BODY	1	MBsBD C3604BD-F	Nickel Plate	DBD04058-5/1
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal	DATE 2022. 01. 10.		 RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017
	Angle	APPROVED BY	S.H.KIM	
MATERIAL		CHECKED BY		KJ COMTECH CO.,LTD. TITLE BNC50 CABLE JB (F/N) RG178
		DRAWN BY	S.Y.EUN	
FINISH		SCALE	UNIT	DWG NO. CN03512-7/1 REVISION 1 SHEET 1 of 1
		2/1	mm	