
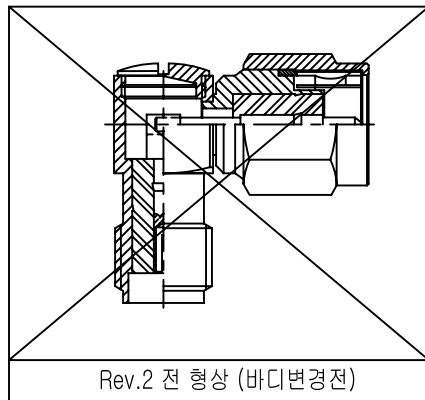


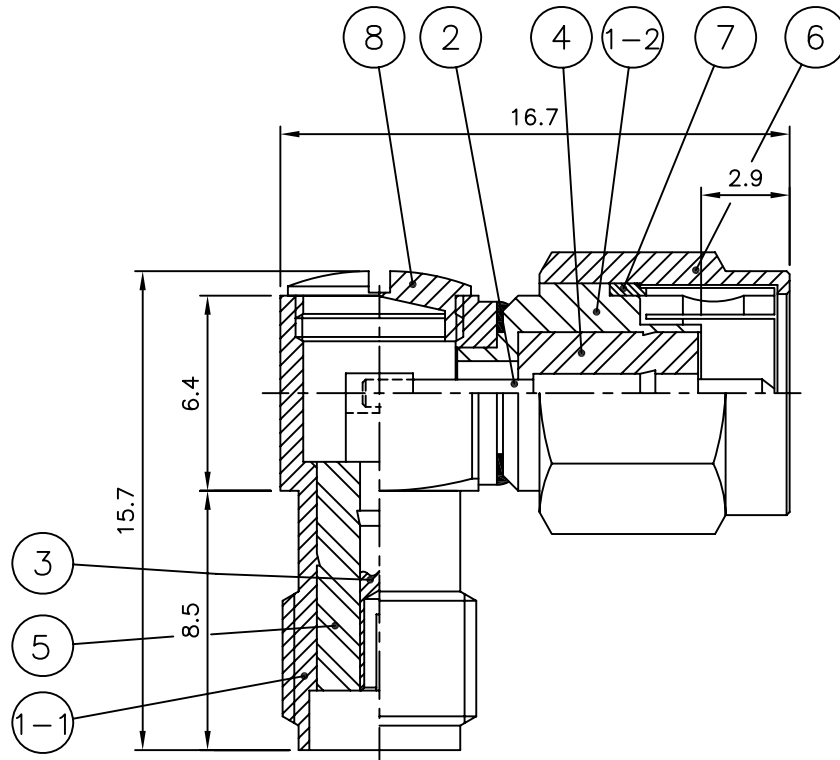

*조립시 주의 사항

⑥번 CAP 억지끼움시 높이 주의 할 것.

REVISION				
REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	I.C.KIM	Y.H.CHOI	2010.11.24.
1	[설변처리No.201609-0001] 조립성 개선으로 인한 BODY 형상및 공차수정	C.K.KIM	I.C.KIM	2016.09.06.
2	은땀 작업개선으로 인한 바디변경	S.Y.EUN	I.C.KIM	2020.03.05.

8	COVER	1	MBsBD C3604BD-F	Gold Plate	DCS00003-5/1
7	JACK	1	BeCu C17300	Gold Plate	DJA00011-5/1
6	CAP	1	MBsBD C3604BD-F	Gold Plate	DCU00004-5/1
5	INSULATOR	1	TEFLON		DIN00090-N/1
4	INSULATOR	1	TEFLON		DIN01856-N/1
3	CONTACT	1	BeCu C17300	Gold Plate	DCT02375-5/1
2	CONTACT	1	MBsBD C3604BD-F	Gold Plate	DCT02374-5/1
1-2	BODY (B)	1	MBsBD C3604BD-F	Gold Plate	DBB00279-5/2 DBD02856-1/2 DBD02856-3/4
1-1	BODY (A)	1	MBsBD C3604BD-F	Gold Plate	DBB00279-5/1 DBD02855-1/2 DBD02855-3/4
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal ± 0.1	DATE 2020. 03. 05.			 RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017			
	Angle $\pm 1^\circ$	APPROVED BY	I.C.KIM					
MATERIAL _____		CHECKED BY			TITLE SMA50 (J) SMA (Push) (P) RA ADAPTOR			
		DRAWN BY	S.Y.EUN					
FINISH _____		SCALE 4/1	UNIT mm		A4	DWG NO.	AD00451-7/1	
						REVISION	2	SHEET