

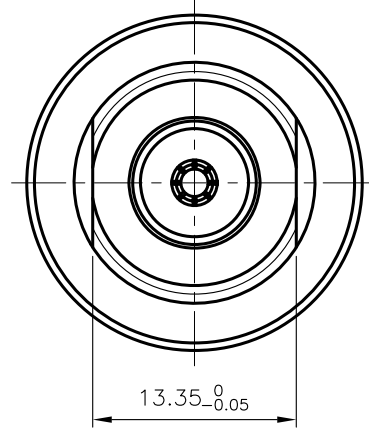
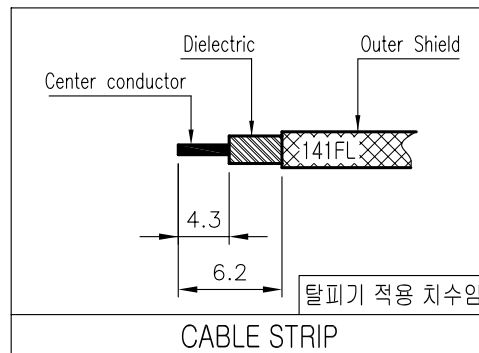


REVISION					
REV	DESCRIPTION	DRAWN	APPR	DATE	
IR	Initial Registration	S.Y.EUN	I.C.KIM	2017.06.28.	
1	[설번처리No.202201-0001] 역지개음이 강하여 Burr 발생, 외경 치수 변경 개선	S.H.KIM		2022.01.03.	

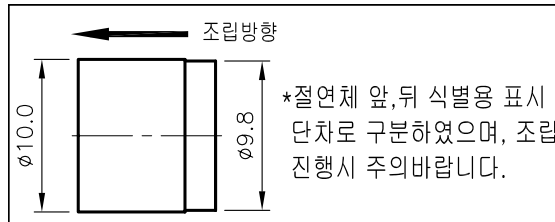

5/8-24 UNEF-2A

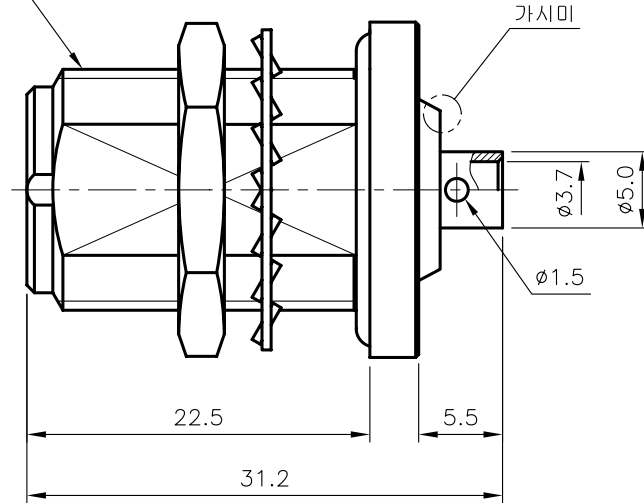

7	WASHER	1	BsS	Nickel Plate	DWA00045-5/1
6	NUT	1	MBsBD C3604BD-F	Nickel Plate	DNT00033-5/1
5	INSULATOR	1	TEFLON		DIN02098-N/1
4	GASKET	1	SILICONE RUB		DGK00046-N/1
3	CONTACT	1	BeCu C17300	Gold Plate	DCT02706-5/4
2	BODY	1	MBsBD C3604BD-F	Gold Plate	DBD03225-5/1
1	BODY	1	MBsBD C3604BD-F	Nickel Plate	DBD03224-5/1
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal	DATE 2022. 01. 03.			 RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017			
	Angle	APPROVED BY						
		$\pm 1^{\circ}$	CHECKED BY			TITLE N50 CABLE JB (F/N) 141TP(50Ω)		
MATERIAL		DRAWN BY S.H.KIM						
FINISH		SCALE	UNIT		A4	DWG NO.	CN02893-7/8	
		2/1	mm			REVISION	I R	SHEET