

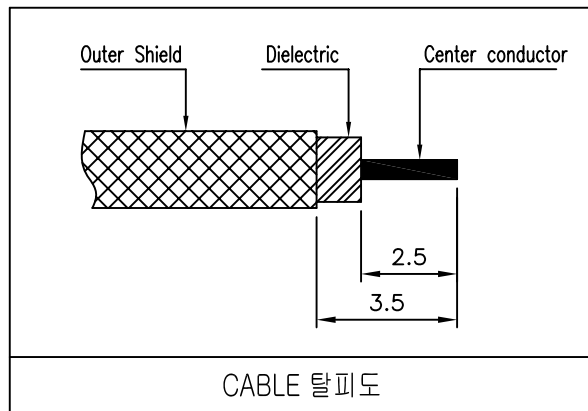


M3 접시머리 볼트
체결 후 돌출 없을 것

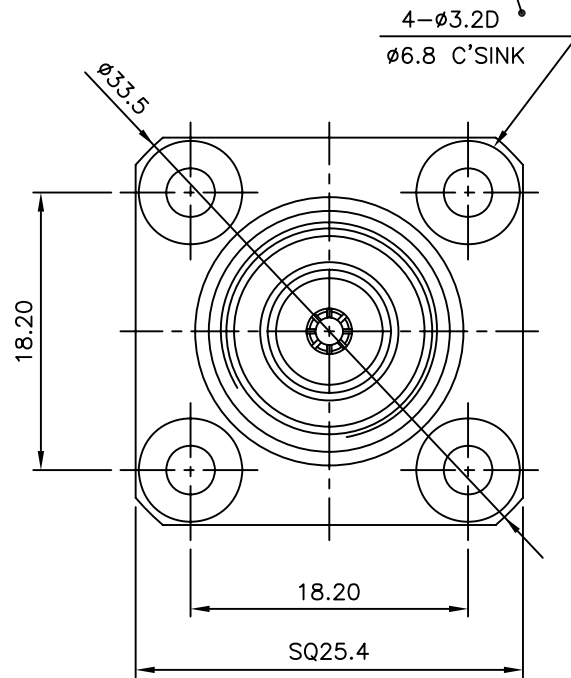

REVISION

REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	I.C.KIM		2016.08.24.
1	[설번No.201710-0021] 현품과 동일하게 PIN 4커팅 → 6커팅 변경	S.Y.EUN	I.C.KIM	2017.10.25.

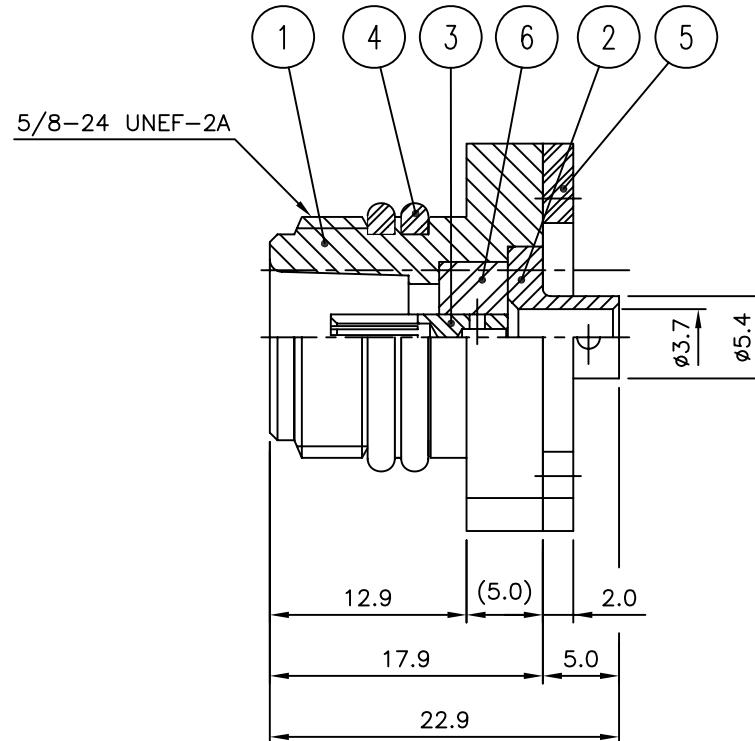

6	INSULATOR	1	TEFLON		DIN02824-N/1
5	GASKET	1	NBR (Black)		DGK00162-N/1
4	GASKET	2	SILICONE RUB (Red)		DGK00029-N/1
3	CONTACT	1	BeCu C17300	Gold Plate	DCT03753-5/1
2	BODY (B)	1	MBsBD C3604BD-F	Nickel Plate	DBD03637-5/1
1	BODY (A)	1	MBsBD C3604BD-F	Nickel Plate	DBD04220-5/1
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal	DATE	2017. 10. 25.
	Angle	APPROVED BY	I.C.KIM
MATERIAL		CHECKED BY	
		DRAWN BY	S.Y.EUN
FINISH		SCALE	2/1
		UNIT	mm



RF & MICROWAVE
TECHNOLOGY
Tel : 82-32-347-8015
Fax : 82-32-347-8017

TITLE	N50 CABLE JS-4H 141
DWG NO.	CN03225-7/2
REVISION	1
SHEET	1 of 1