
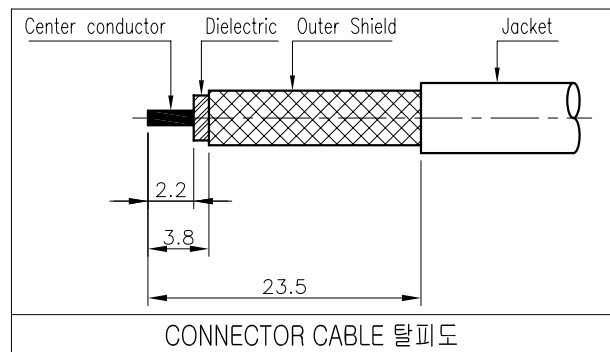


A

B

C

D

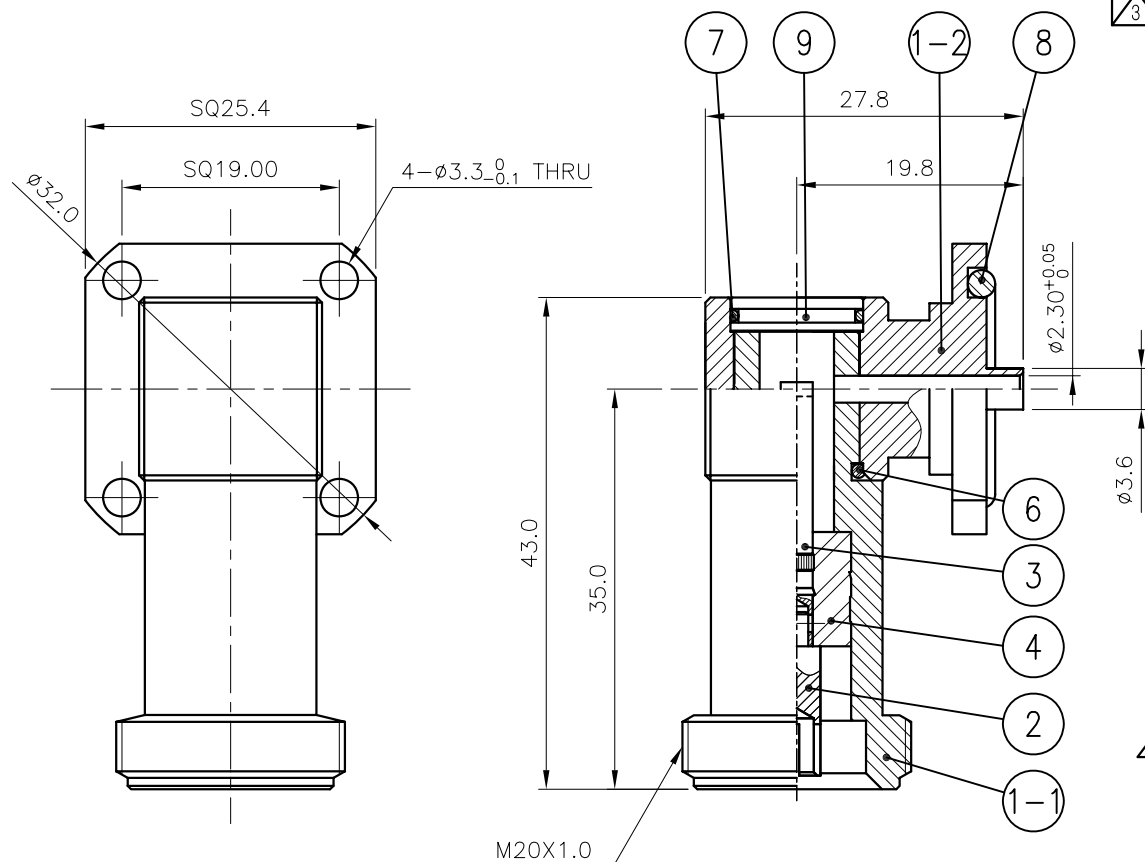

REVISION

REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	H.J.LEE	I.C.KIM	2015.11.12.
1	[설번No.201601-0004] GASKET 튀어나오는 현상으로 인한 BODY 수정	H.J.LEE	I.C.KIM	2016.01.11.
2	[설번No.201602-0010] 업체 요청으로 인한 BODY 사각 면취 변경	H.J.LEE	I.C.KIM	2016.02.16.
3	[설번No.201602-0015] GASKET 튀어나오는 현상으로 인한 GASKET 변경 및 공차 관리로 인한 BODY 치수 및 공차 변경	H.J.LEE	I.C.KIM	2016.02.24.

A

B

C

D

9	COVER	1	MBsBD C3604BD-F	SUCO Plate	DCO00090-5/3
8	GASKET	1	SILICONE RUB		DGK00047-N/1
7	GASKET	1	NBR		DGK00176-N/1
6	GASKET	1	SILICONE RUB		DGK00269-N/2 DGK00028-N/1
5	FERRULE	1	MBsBD C3604BD-F	Nickel Plate	DFE00170-5/1
4	INSULATOR	1	TEFLON		DIN02512-N/1
3	CONTACT(B)	1	MBsBD C3604BD-F	Silver Plate	DCT03593-5/1
2	CONTACT(A)	1	BeCu C17300	Silver Plate	DCT03330-5/3
1-2	BODY(B)	1	MBsBD C3604BD-F	SUCO Plate	DBB00431-5/1 DBD04071-3/1
1-1	BODY(A)	1	MBsBD C3604BD-F	SUCO Plate	DBD04070-3/1
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal	DATE	2016. 02. 24.	
	Angle	APPROVED BY	I.C.KIM	
MATERIAL	±1°	CHECKED BY		
		DRAWN BY	H.J.LEE	
FINISH		SCALE	UNIT	
		1.5/1	mm	
		TITLE		RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017
		DWG NO.		CN03525-7/1
		REVISION		3
		SHEET		1 of 1



TITLE
4.1/9.5DIN50 CABLE JL-4H 85FJ

A4