
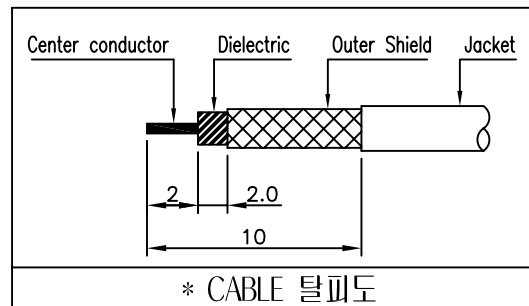
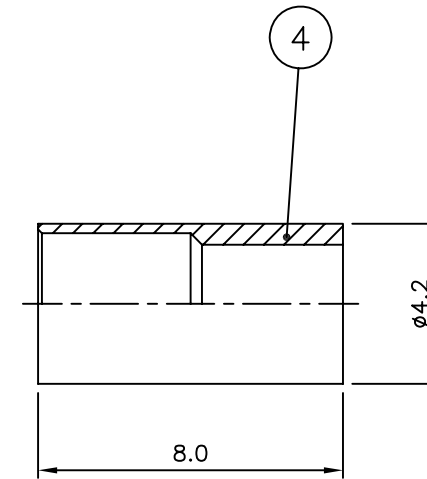


REVISION				
REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	S.Y.EUN	I.C.KIM	2019.04.02.
1	[설번No.201907-0001] 역지끼움 불량으로 인한 바다변경	S.Y.EUN	I.C.KIM	2019.07.01.
2	[설번No.202011-0001] BODY(B) 조립 시 스프링 보임 → 외경 치수 변경	S.Y.EUN	I.C.KIM	2020.11.13.

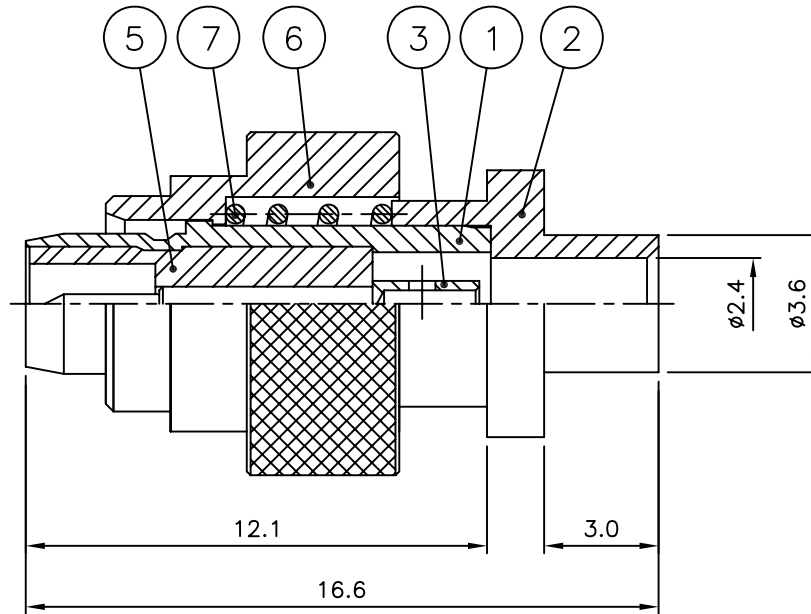

7	SPRING	1	SUS	부동태처리	DSR01102-5/1
6	CAP	1	MBsBD C3604BD-F	Nickel Plate	DCU02233-5/2
5	INSULATOR	1	TEFLON		DIN02021-N/1
4	FERRULE	1	MBsBD C3604BD-F	Nickel Plate	DFE00166-5/1
3	CONTACT	1	MBsBD C3604BD-F	Gold Plate	DCT02613-5/1
2	BODY (B)	1	MBsBD C3604BD-F	Nickel Plate	DBD03089-5/4 DBD03089-5/3 DBD03089-5/2
1	BODY (A)	1	MBsBD C3604BD-F	Nickel Plate	DBD03088-5/5
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal	DATE 2020. 11. 13.		 RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017
	Angle	APPROVED BY	I.C.KIM	
MATERIAL		CHECKED BY		TITLE SMBL50 CABLE PS MF86
		DRAWN BY	S.Y.EUN	
FINISH		SCALE	5/1	DWG NO. CN02814-7/4 REVISION 2
		UNIT	mm	
				SHEET 1 of 1