
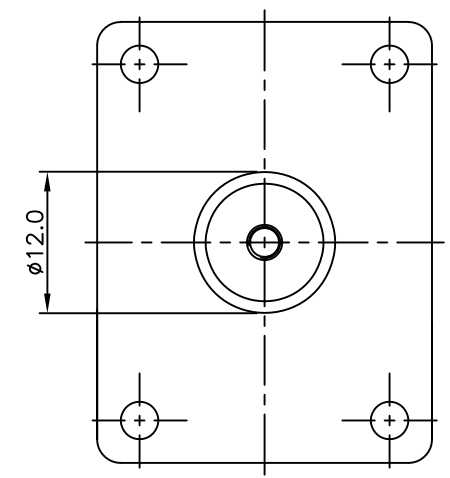
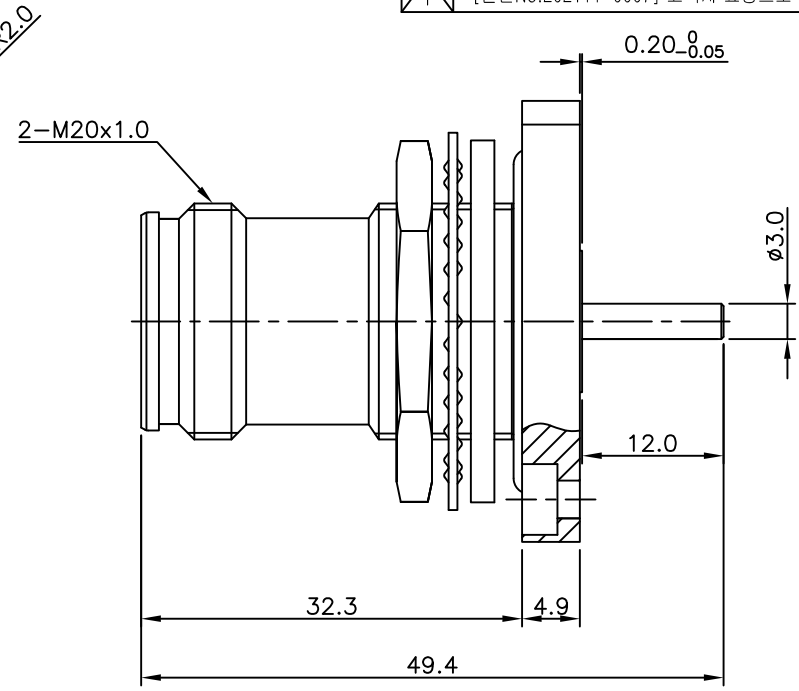


2	절연체 조립시 퍼짐 현상으로 절연체 외경 및 길이 수정	S.H.KIM		2022. 09. 29.
3	[설번No.202211-0003] 절연체 조립시 늘어나는 현상으로 절연체 치수 재수정	S.Y.EUN	S.H.KIM	2022. 11. 03.

REVISION				
REV	DESCRIPTION	DRAWN	APPR	DATE
IR	Initial Registration	S.Y.EUN	I.C.KIM	2020. 06. 03.
1	[설번No.202111-0007] 고객사 요청으로 인한 내치와사 추가	S.Y.EUN	I.C.KIM	2021. 11. 23.

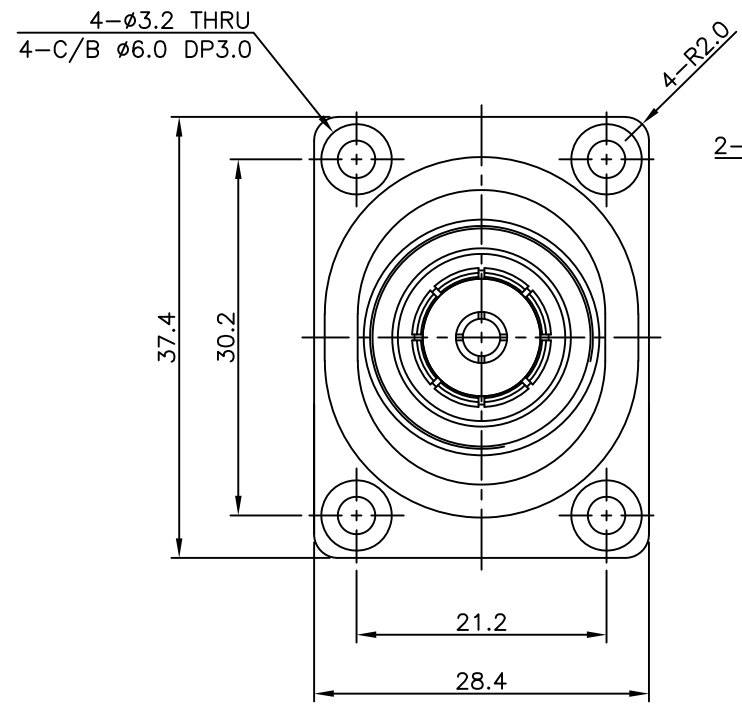

* O-RING 가스켓 놀림량 25%~30% 적용

9	END CAP	1	PVC	RED	DGK00224-N/1
8	WASHER	1	SUS	Passivated	DWA00139-5/1
7	WASHER	1	MBsBD C3604BD-F	Nickel Plate	DWA00142-5/2
6	NUT	1	MBsBD C3604BD-F	Nickel Plate	DNT00107-5/2
5	GASKET	1	SILICONE		DGK00190-N/1
4	JACK	1	MBsBD C3604BD-F	Silver Plate (3μm)	DJA00228-5/6
3	INSULATOR	1	TEFLON		DIN03044-N/3 DIN03044-N/2
2	CONTACT	1	BeCu C17300	Silver Plate (6μm)	DCT04137-5/1
1	BODY	1	MBsBD C3604BD-F	이원합금(Ni/Tin)	DBD04547-5/1
NO.	DESCRIPTION	Q'TY	MATERIAL	PLATING	CODE

TOLERANCE	Decimal ±0.2	DATE 2022. 11. 03.		 RF & MICROWAVE TECHNOLOGY Tel : 82-32-347-8015 Fax : 82-32-347-8017	
	Angle ±1°	APPROVED BY	S.H.KIM		
MATERIAL _____		CHECKED BY		TITLE 4.3/10 DIN50 SOLDER END JB-4H	
		DRAWN BY	S.Y.EUN		
FINISH _____		SCALE 1.5/1	UNIT mm	 A4	DWG NO. CN03876-7/2
					REVISION 3